

2005-07 GMC Envoy 5.3L 2005-07 Chevrolet Trailblazer 5.3L 2005-06 Pontiac GTO 6.0L 2007-Up Chevy/GMC 1500, 2500, 3500 Trucks & SUVs with 4.8L, 5.3L, 6.0L, 6.2L #3267 TORQUE-CURVE MPFI SPACER

INSTALLATION INSTRUCTIONS

Important! Read all instructions before you begin installation.

THIS KIT CONTAINS

O-ring Hamburger's Performance Spacer 4 - 6mm X 60mm Bolts

4 - 6mm Flat Washers

6mm Flat Head Bolt

TOOL LIST

5/32" 4mm Sockets 10mm Deep Socket Allen Wrench

DISCONNECT NEGATIVE (-) BATTERY CABLE

3/4"

Extension Plate

- the radiator hose and separate the tube from the plastic clamp Lift up on the front of the beauty cover and remove it from the engine area (Ref. 1). Then push down on
- ω Gently pull the breather tube towards you to disconnect it. Then loosen the hose clamp on the at the throttle body (Ref. 2), and at the other end, and remove the tube from the engine area intake tube
- With a 10mm socket remove the (2) nuts and the (2) bolts that hold the throttle body to the intake manifold (Ref. Set the throttle body aside. Don't disconnect the wiring harness
- Using a 4mm socket, remove the (2) studs from the manifold
- 6 Install the (1) O-Rings on Hamburger's Spacer (You may need to stretch slightly for fitting)
- Install the Hamburger's Spacer with throttle body using (4) 6mm x 60mm bolts & (4) 6mm flat washers (Ref. 4).

 Note: The O-ring side of the spacer faces the throttle body.
- တ 3/4" Extension Plate by threading the bolt into the hole where you removed the "Ball Stud" from. Face the spacer toward the front of the vehicle and tighten bolt with the 5/32" allen wrench. Next thread the "Ball Stud" into the forward hole in the 3/4" extension plate and tighten (Ref. 6). Face the install the
- 9 Remove the factory grommet from the intake tube and install it on the "Ball Stud" with the small diameter facing upward (Ref. 7).
- Reinstall the intake tube (using caution to center the intake tube hole over the grommet just installed hose clamps on the tube Some adjustments may be required to seat the grommet correctly back into the intake tube. Tighten the
- Reconnect the breather tube and the plastic clamp from step 2. Then reinstall the beauty cover (Ref. 8).
- Reconnect negative battery cable













Ref. 6



Ref.



Ref. 8

website: 12438 Putnam Street • Whittier, www.hamburgersperformance.com S 90602 tel (562) 921-0404 • fax (562) 921-7515 email: techsupport@tdperformance.com